

**Experience
The
Nordic
Difference**



Nordic Cooling
Units

**OEM Quality Replacement
Cooling Units**

**Dometic
Replacements**

**Norcold
Replacements**



**Reliability...
Guaranteed**


All cooling units sold on exchange basis only—
SEND EXCHANGE CORES BACK TO NORDIC COOLING UNITS

If your RV refrigerator isn't cooling and smells of ammonia, the cooling unit has failed and needs to be replaced. The number one reason cooling units fail is because they rust out and start leaking ammonia. Also, if your unit has been run off-level, a blockage can form inside the cooling unit, preventing proper circulation of the charge solution.


Repairing your refrigerator with a remanufactured Nordic Cooling Unit is significantly less expensive than replacing the entire RV refrigerator.

COOLING UNIT INSTALLATION TIPS


- Place 1/4 inch bead of thermal mastic on any exposed metal tubing in the foam pack that comes in contact with the aluminum fins. Thermal mastic is not a sealant. It is used to transfer the cold from the cooling unit into the freezer and refrigerator. **DO NOT** use thermal mastic as a sealant around the foam pack! The foam tape around the foam pack eliminates the need for any sealant around the foam pack.
- We recommend a light film of petroleum jelly be applied to the foam pack cavity before placing the cooling unit into the cabinet.
- Seal around the cardboard back with foil tape.
- Put the gas flue baffle back into place.
- Check that the heating element is working properly and in the heater sleeve, not just loose in the insulation
- Make sure the freezer and refrigerator screws that secure the cooling unit are tight.
- Make sure the refrigerator is level once installed back into the cabinet and that the camper is level before operating the refrigerator.

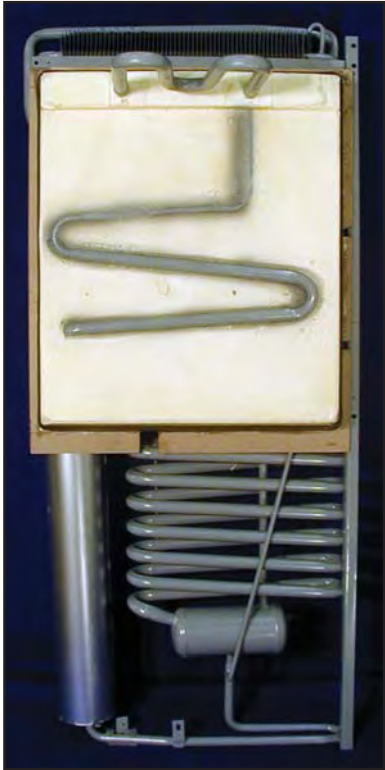

66592

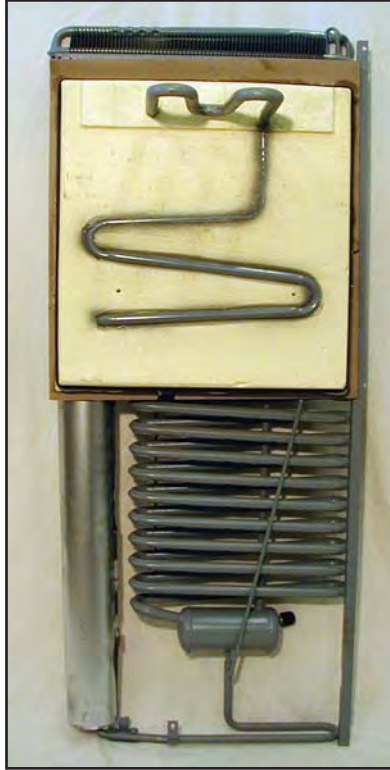

60787

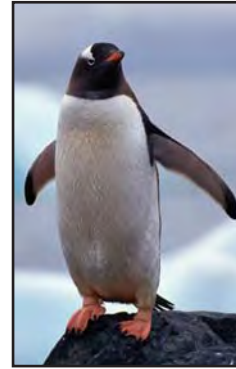

DOMETIC MODELS COVERED BY NORDIC PART #

ORDER #	NORDIC #	MFG #	FRT	DESCRIPTION
	5536	9283349000	UPS	RM360, RM361, RM2300, RM2301
	5531	9283349000	UPS	RM2310
	5533	2934838092	UPS	RM2332
	5546	9283359009	UPS	RM460, RM461, RM2400, RM2401
	5541	9283359009	UPS	RM2410
	5542	2934405099	UPS	RM2452, RM2453
	5525	9283609007	UPS	RM660, RM661, RM663, RM2500, RM2501
	5501	2934860096	UPS	RM2510
	5552	2934502096	UPS	RM2552, RM2553
	5554	2934509098	UPS	RM2554, RM2551
	5561	9285319001	UPS	RM761, RM763
	5513	9286169009	UPS	RM1300, RM1301, RM1302, RM1303
60699	5526	2934801099	UPS	RM2600, RM2601, RM2602, RM2603, RM2610, RM3600, RM3601, RM3602, RM3603, RM3604
66592	5564	2934803996 /2934803095	UPS	RM2604, RM2607, RM2611, RM2612, RM3607
	5502	2934809100	UPS	RM2620
	5528	2934901097	UPS	RM2800, RM2801, RM2802, RM2803, RM2810, RM3800, RM3801, RM3802, RM3803, RM3804
60787	5584	2934903994 /2934903093	UPS	RM2804, RM2807, RM2811, RM3807
	5520	2934909108	UPS	RM2820

For models not listed, call Nordic for availability.

REFRIGERATOR COOLING UNITS

**PARTS QUICK
REFERENCE**

Q

In Section Q: Atwood Coleman (RVP) Cooling Units Dometic Norcold Powerhouse Suburban Thetford Wedgewood X-Reference

DOMETIC MODELS COVERED BY NORDIC PART

ORDER #	NORDIC #	MFG #	FRT	DESCRIPTION
---------	----------	-------	-----	-------------

IMPORTANT! WHEN ORDERING THE FOLLOWING FOUR NORDIC PART NUMBERS:

#5562-605A, # 5562-606A, # 5582-805A AND # 5582-806A

- 1.) First look on the **absorber tank** for the cooling unit model number.
This number will clarify which type to order: 605A, 606A or 805A, 806A.
- 2.) If the model number is not found on the absorber tank, **Special Attention** must be paid to the **Gas valve bracket** to which the Gas valve assembly attaches.




64944
Model #605A Old Style
(Box Shaped Bracket)



Box Shaped Bracket
Models #605A or 805A
(Old Style)

** If the unit has a **box shaped bracket** (Old Style) to which the gas valve assembly attaches order Nordic Part # 5562-605A or Part # 5582-805A depending on refrigerator size.

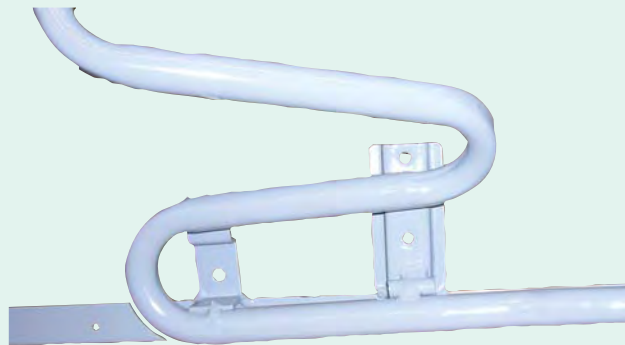

Flat Vertical Bracket
Models #606A or 806A
(New Style)


*If the unit has a **flat, vertical bracket** (New Style) to which the gas valve assembly attaches order Part # 5562-606A or Part # 5582-806A depending on refrigerator size.

64944	5562-605A	2934605094	UPS	RM3662, RM3663, RM2652, RM3652 (Model #605A Old Style)**
	5562-606A	2934606100	UPS	RM3662, RM3663, RM2652, RM3652 (Model #606A New Style)*
64943	5582-805A	2934805090	UPS	RM3862, RM3852, RM3863, RM2852, RM2862, RM4872, RM4873, NDR 1062 (Dometic Model #805A Old Style)**
	5582-806A	2934806106	UPS	RM3862, RM3852, RM3863, RM2852, RM2862, RM4872, RM4873, NDR 1062 (Dometic Model #806A New Style)*


For models not listed, call Nordic for availability.



60706

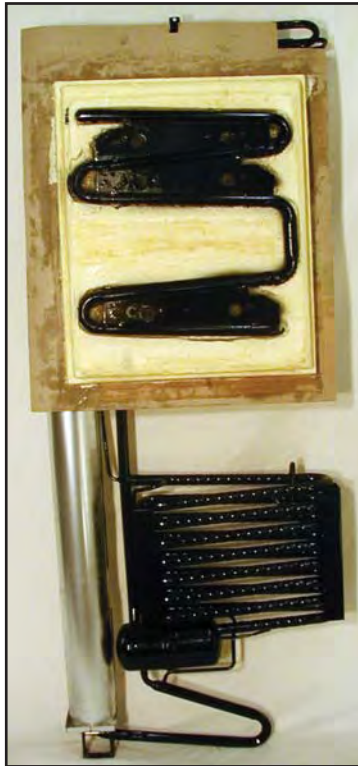

64942

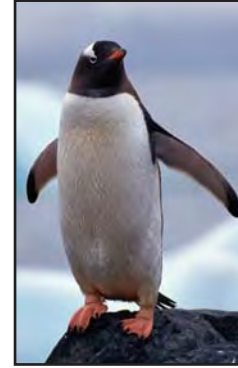

NORCOLD MODELS COVERED BY NORDIC PART #

ORDER #	NORDIC #	PART #	FRT	DESCRIPTION
	3342	616146	UPS	NC442 / NC443
	3374	614428	UPS	NC774 EG
	3376	614512	UPS	NC776 EG
	3352	616871	UPS	NC452 / NC453 / NC652 / NC653 / NC6052 / NC875
		<p><i>Important! When ordering the following four Nordic Part Numbers: #3362, #3382, #3338, and #3310</i></p> <p>Special Attention must be paid to the burner style for replacement units NC8662, NC8663, NC8683, NC876, NC878:</p> <p>** If the unit has a <i>standard (old style) burner</i> with a 5/8" heating element order NC838 or NC8310 depending on refrigerator size.</p> <p>*If the unit has a <i>horizontal (new style) burner</i> with an "L" shaped 3/8" heating element order NC662 or NC682 depending on refrigerator size.</p>		
60706	3362	616152 / 614383	UPS	NC662 / NC6062 / NC6162 / NC663 / NC8662 NC462 / NC463 Horz* / NC876 Horz*
60704	3382	616156 / 614999	UPS	NC682 / NC683 / NC482 / NC6082 / NC6182 NC8682 / NC8683 / NC483 Horz* / NC878 Horz*
	3338	614383	UPS	NC838 / NC778 / NC8662 / NC8663 / NC876 Std**
	3310	614999	UPS	NC8310 / NC8682 / NC8683 Std** / NC878 Std**

REFRIGERATOR COOLING UNITS

**PARTS QUICK
REFERENCE**

Q

In Section Q:	Atwood	Coleman (RVP)	Cooling Units	Dometic	Norcold	Powerhouse	Suburban	Thetford	Wedgewood	X-Reference
----------------------	--------	---------------	---------------	---------	---------	------------	----------	----------	-----------	-------------

NORCOLD MODELS COVERED BY NORDIC PART

ORDER #	NORDIC #	PART #	FRT	DESCRIPTION
64941	3396	630371	UPS	NC962 / NC962IM / NC963 / NC610 / NC611 / NC620 / NC621 / NC623 NC6203 / NC6213 / NC640 / NC641 / NC6403 / NC6413 / NC9162 / NC9163
64942	3398	630657	UPS	NC982 / NC983 / NC820 / NC821 / NC822 / NC840 NC841 / NC842 / NC843 / NC8413 / NC9182RT / NC9183
<i>For models not listed, call Nordic for availability.</i>				

SERVEL MODELS COVERED BY NORDIC PART

ORDER #	NORDIC #	MFG #	FRT	DESCRIPTION
	6619	2943700100	UPS	S619, S620, S630, S619.006, S619.007
	6819	2943700118	UPS	S819.002, S819.003, S819.006, S819.007, S820.004, S820.013, S830.004, S830.013
	6621	2934804010	UPS	S1621, S1631, S620.014, S620.015, S630.014, S630.015
	6681		UPS	S1821, S1831, S820.014, S820.015, S830.014, S830.015
<i>For models not listed, call Nordic for availability.</i>				

REPLACEMENT COOLING UNITS FOR NORCOLD MODELS


REPLACEMENT COOLING UNITS FOR DOMETIC MODELS



60706



64942

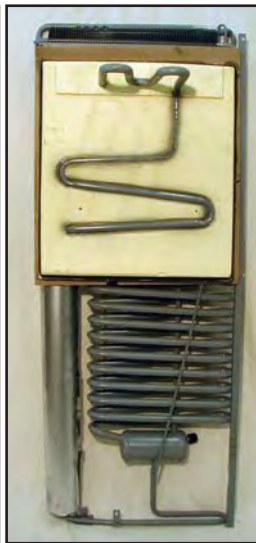

60787



64944



66592

For more information on other models, visit
www.nordiccoolingunits.com under parts list!